

Work Order ID 74330

Wednesday, September 28, 2011 1:20:26 PM

Page 1

Item ID: D212-664-101

Accept

Setup Start

Revision ID:

Stop

Item Name: Crosstube Fwd

Start Date: 9/28/2011 Start Qty: 1.00

Cust Item ID:

Required Date: 10/19/2011 Req'd Qty: 1.00

Customer:

Reference:

Approvals:

Process Plan: M L J

Date: 11/09/28 Tooling:

Date:

Run Start

QC:

Date:

SPC (Y/N):

Date:

Stop

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D212-664-141

Rev D (DEO)

100

0.00



DOCUMENT CONTROL

DC

Memo

0.00

Document Control

Photocopy bluefile and create labels as per PPP D212-664-101 CHG005

110

0.00



Pick Kit

Packaging

Packaging

Memo

0.00

Packaging

120

0.00



BENDING MACHINE - CROSSTUBES

CNC Bend 2

Memo

0.00

CNC Alpha 160 Bender

Bend tube as per Dwg D212-664-141 using CNC bender program 212-fw and Folio D212-664-101

B74330 D212-664-101

W/O: 74330		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D212-664-101 PAR #: N/A Fault Category: X-tube NCR: Yes ☒ No ☐ DQA: N/A Date: 11.10.28
 Resolution: use on in Disposition: use on in QA: N/C Closed: ☒ Date: 11/10/31

NCR: 11-939		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
11.10.5	130	MAT'L ECCENTRICITY WAS NOTICED AFTER BENDING, SEE ATTACHED EMAIL <i>process</i>	<i>CP</i> 11.10.05 <i>CS/042</i>	Acceptable. SEE ATTACHED EMAIL. PRODUCTION LOCKS DIMS TO APPROVE TEST EXTENT OF ECCENTRICITY.	<i>N/A</i>	<i>S</i> 11/10/06	<i>CP</i> 11.10.05 <i>CS/042</i>	<i>S</i> 11/10/06

NOTE: Date & initial all entries

Work Order ID 74330

Wednesday, September 28, 2011 1:20:26 PM



Page 2

Item ID: D212-664-101

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Fwd

Start Date: 9/28/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 10/19/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130 QC Quality Control	QC15- Crosstube Dimensional Check Memo	0.00 0.00				(10)			
140 Crosstubes Crosstubes	Crosstubes Memo 1-Drill pilot holes in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549, using drill table DT8577, set-up towers in hole #7 as per QSI 10 2-Ream hole to finish size in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes. 3-Scribe part # and batch # using vibrating stylus as per Dwg D212-664-141 4-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D212-664-141	0.00 0.00							

ET
11-10-06ET
11-10-11

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 74330

Wednesday, September 28, 2011 1:20:26 PM



Page 3

Item ID: • D212-664-101

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Fwd

Start Date: 9/28/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 10/19/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

150

Crosstubes Chemical Conversion

0.00



HandFXtube

Memo

0.00

Hand Finishing Crosstubes

Chemical Conversion Coat within 24 hours of bending and drilling

RT 11-10-11

160

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

S. 11/10/11



170

Outsource process - NDT per QSI038 4.1

0.00



Outsource2

Memo

0.00

Outsource process - NDT

Liquid Penetrant Inspection as per QSI 038
Issue P/O: 15157
LPI as per ASTM 1417 Level 2
Attach copy of NDT results to work order

11-10-11

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 74330

Wednesday, September 28, 2011 1:20:26 PM



Page 4

Item ID: D212-664-101

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Fwd

Start Date: 9/28/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 10/19/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
180 	Receive & Inspect for Damage & Mat'l Certs	0.00							
Packaging	Packaging								
Packaging	Memo	0.00							
	Ensure copy of NDT results attached to work order.								
190 	QC5- Inspect part completeness to step on W/O	0.00							
QC	QC								
Quality Control	Memo	0.00							
	Inspect for damage & ensure results are as per Dwg D212-664-141								

Per 10/14 @

M 11 10 17 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 74330

Wednesday, September 28, 2011 1:20:26 PM



Page 5

Item ID: D212-664-101

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Fwd

Start Date: 9/28/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 10/19/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

200 Spray Painting per QSI005 4.2

0.00



SprayPaint

Memo

0.00

Spray Painting

1-Prime inside and outside crosstube as per QSI 005 4.2

2-Paint outside crosstube as per DEO D212-667-141 with White Imron as per QSI 005 4.2

PRIME:

Start Time: 3:00

Finish Time: 4:00

11/10/17 ①

PAINT:

Start Time: 9:30

Finish Time: 11:00

11/10/18 ①

11/10/18 ①

210 QC14- Inspect Spray Paint

0.00



QC

Memo

0.00

Quality Control

Then, Wrap in plastic bag to protect from scratches

11-10-19

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 74330

Wednesday, September 28, 2011 1:20:26 PM



Page 6

Item ID: D212-664-101

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Fwd

Start Date: 9/28/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 10/19/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
220 Crosstubes	Crosstubes	0.00				<u>nl</u>	<u>11</u>	<u>10-20</u>	<u>①</u>
Crosstubes	Memo 1-Abrade mating surfaces of support and crosstube with 400 grit sandpaper, clean the area with 4105S wash 'n' wipe 2-Install supports with Proseal 890 per DSI9563 and QSI 015 A/R Proseal 890 Batch: <u>118234</u> 3- Torque bolts as per dwg <u>> nl 11/10/21</u>	0.00							
230 QC	QC6- Inspect dimensions to drawing	0.00				<u>ⓧ</u>			
Quality Control	Memo	0.00							
240 Packaging	Pick Kit	0.00							
Packaging	Memo	0.00							

Sp 11-10-26.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 74330

Page 7

Wednesday, September 28, 2011 1:20:26 PM

Item ID:- D212-664-101

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Fwd

Start Date: 9/28/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 10/19/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
250	QC4- 100% Inspect kits for completeness	0.00							
QC	Memo	0.00							
Quality Control									
260	Packaging	0.00							
Packaging	Memo	0.00							
Packaging	Identify and pack for shipping as per PPP D212-664-101								
270	QC21- Final Inspection - Work Order Release	0.00							
QC	Memo	0.00							
Quality Control									

8/10/26

Rec H

11/10/26

11/10/28

MF 11-10-29

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Wednesday, September 28, 2011 1:20:31 PM

Page 1

Work Order ID: 74330

Parent Item: D212-664-101

Parent Item Name: Crosstube Fwd



Start Date: 9/28/2011

Required Date: 10/19/2011

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:E 04.02.16 Reformat KJ/DS
 IPP Rev:F 06-03-29 Remove Coments on Pick List JLM
 IPP Rev:G 07-04-30 As per Rev C JLM IPP Rev:H
 11.04.26 inspection strip ecn 11-549 EC verified by:DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D212-664-101TRN		Manufactured	No			110	Each	2.0000	1	1			
Crosstube Turning Detail													

Location	Loc Qty	Loc Code
FG 74247	1	
54731	0	
54732	0	
73708	1	
FG046	1	
68584	0	
73709	1	

① JW/MB 11-10-04

D3595-063-450 Manufactured No

230 Each 43.5600 4 4.210526



RUBBER CUSHION

Location	Loc Qty	Loc Code
LG	9.76	
67353	3	
68893	6	
70113	0.56	
71354	0.2	
LG055	33.8	
72967	33.8	

W 11-10-20

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Wednesday, September 28, 2011 1:20:31 PM

Work Order ID: 74330

Parent Item: D212-664-101

Parent Item Name: Crosstube Fwd

Start Date: 9/28/2011

Required Date: 10/19/2011

Start Qty: 1.00

Required Qty: 1.00

MS21920-25

Purchased

No

220

Each

60.0000

4

4



Clamp(per MIL-DTL-8783C)



W 11-10-20

Location

Loc Qty

Loc Code

LG

54

113281

0

113282

0

118142

4

118183

50

LG050

6

116264

2

117998

4

D2893-1

Manufactured

No

220

Each

2.0000

2

2



2.75 Support



W 11-10-20

Location

Loc Qty

Loc Code

LG052

2

72586

2

72865

D3428-1

Manufactured

No

240

Each

29.0000

1

1



Placard



Sp 11-10-26

Location

Loc Qty

Loc Code

ST053

29

72048

9

73498

20

1x

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Wednesday, September 28, 2011 1:20:31 PM

Work Order ID: 74330

Parent Item: D212-664-101

Parent Item Name: Crosstube Fwd

Start Date: 9/28/2011

Required Date: 10/19/2011

Start Qty: 1.00

Required Qty: 1.00

AN6-35A

Purchased

No

240

Each

72.0000

4

4

BOLT

Location

Loc Qty

Loc Code

ST343

72

118422

42

118838

30

AN6-36A

Purchased

No

240

Each

73.0000

4

4

Bolt

Location

Loc Qty

Loc Code

ST343

73

118012

1

118422

42

118838

30

MS21042L6

Purchased

No

240

Each

1,904.000

6

6

Nut

Location

Loc Qty

Loc Code

ST300

904

117677

200

118384

8

118927

96

118968

600

ST518

1000

119075

1000

AN960JD616

NAS1149D0663J

Purchased

No

240

Each

0.0000

18

18

Washer

m18614

SP 11-10-26

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order: 74330
Description: Crosstube High Fwd (205/212/412)	Part Number: D212-664-101
Inspection Dwg: D212-664-141 Rev: D	Page 1 of 1

Required Dimension	Min	Max
Height	26.79	27.05
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.7

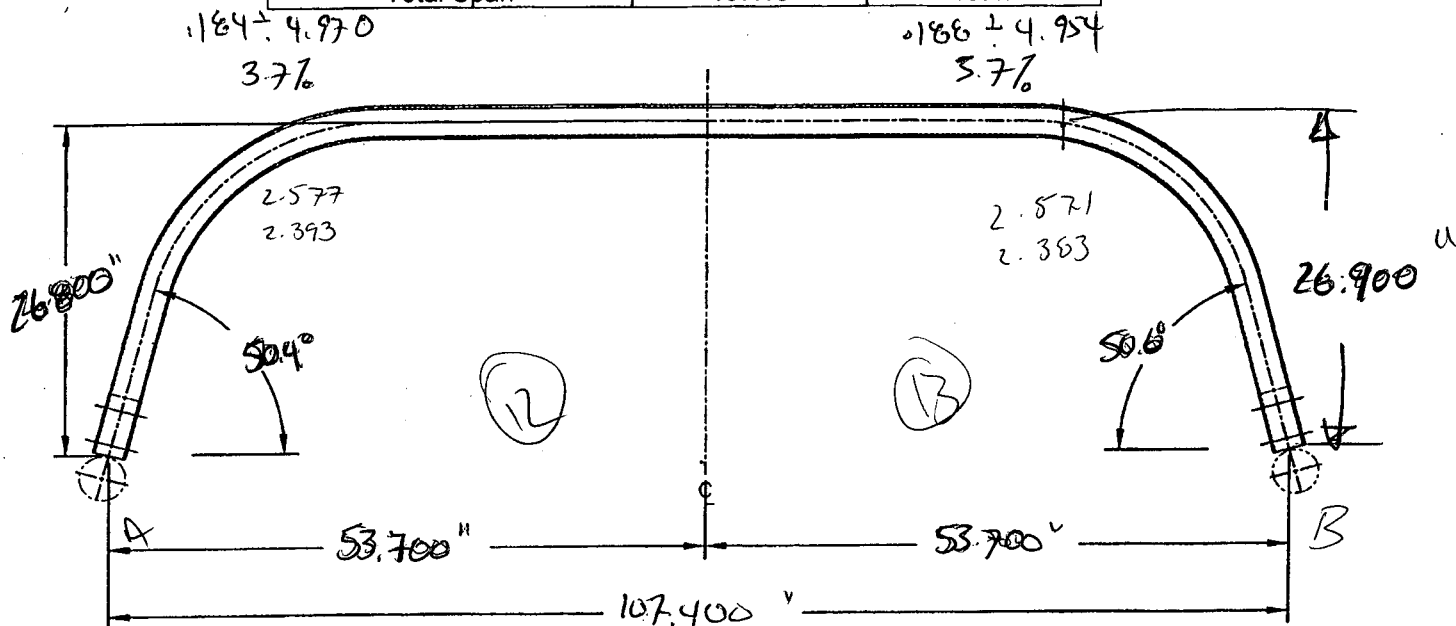

Comments
Side A = 3.7% crushing @ 12 Passes
Side B = 3.7% crushing @ 13 Passes

QC15 Inspection	<i>S</i>
Date	11/2/06

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	07.05.31	Dimensions updated per Dwg Rev C	KJ/JM	
C	10.04.01	Dwg Rev updated	KJ <i>[Signature]</i>	<i>[Signature]</i>

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Item	Qty -141	Qty -141B	Part Number	Description
1	X		D212-664-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
2		X	D212-664-141B	CROSSTUBE ASSEMBLY (214 HIGH FWD)
3	1	1	D6005-128	CROSSTUBE
4	2	2	D2893-1	SUPPORT
5	4	4	D3595-063-450	RUBBER CUSHION
6	4	4	MS21920-25	CLAMP (OR MS21920-26)
7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6005-128
FINISHED LENGTH = 126.514±0.020
- FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF
USING VIBRATING STYLUS
- WEIGHT: D212-664-141 = 33.6 lbs (PER IIN-D212-664)
D212-664-141B = 33.6 lbs (PER IIN-D212-664)
- PART IS SYMMETRIC ABOUT CENTERLINE.
- RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS
5% BASED ON O.D.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF
D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER
INSTALLATION AND PRIOR TO PACKAGING.
- INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE D2893-1
SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE
SUPPORT.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE
SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR
DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND
MARKS ARE UNACCEPTABLE.
- TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT
HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER

NO. 74330 M.C.J. 11/09/28

REMOVED FROM UNDER REVIEW PER
UNDER REVIEW EGN H11-G14
4/11/09
FOR PRO-SEALING SURFAT 4/11/09

DEO ATTACHED

RELEASED
2009-10-29

D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -141B (ZN B4-2, D4-2); REMOVED REF & ADD TOLERANCES (ZN B4-3, C6-3, C8-3 & B6-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4	RF	09.09.30
C	REMOVE -851 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA DRAWING NO. REV. D D212-664-141 SHEET 1 OF 4 TITLE SCALE XTUBE ASSY (205/212/412 HI FWD) NTS <small>COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONVICTION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD</small>	
DRAWN	RF		
CHECKED	PH		
MFG. APPR.	PH		
APPROVED	PH		
DE APPR.	PH		
DATE	09.09.30		

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

74330

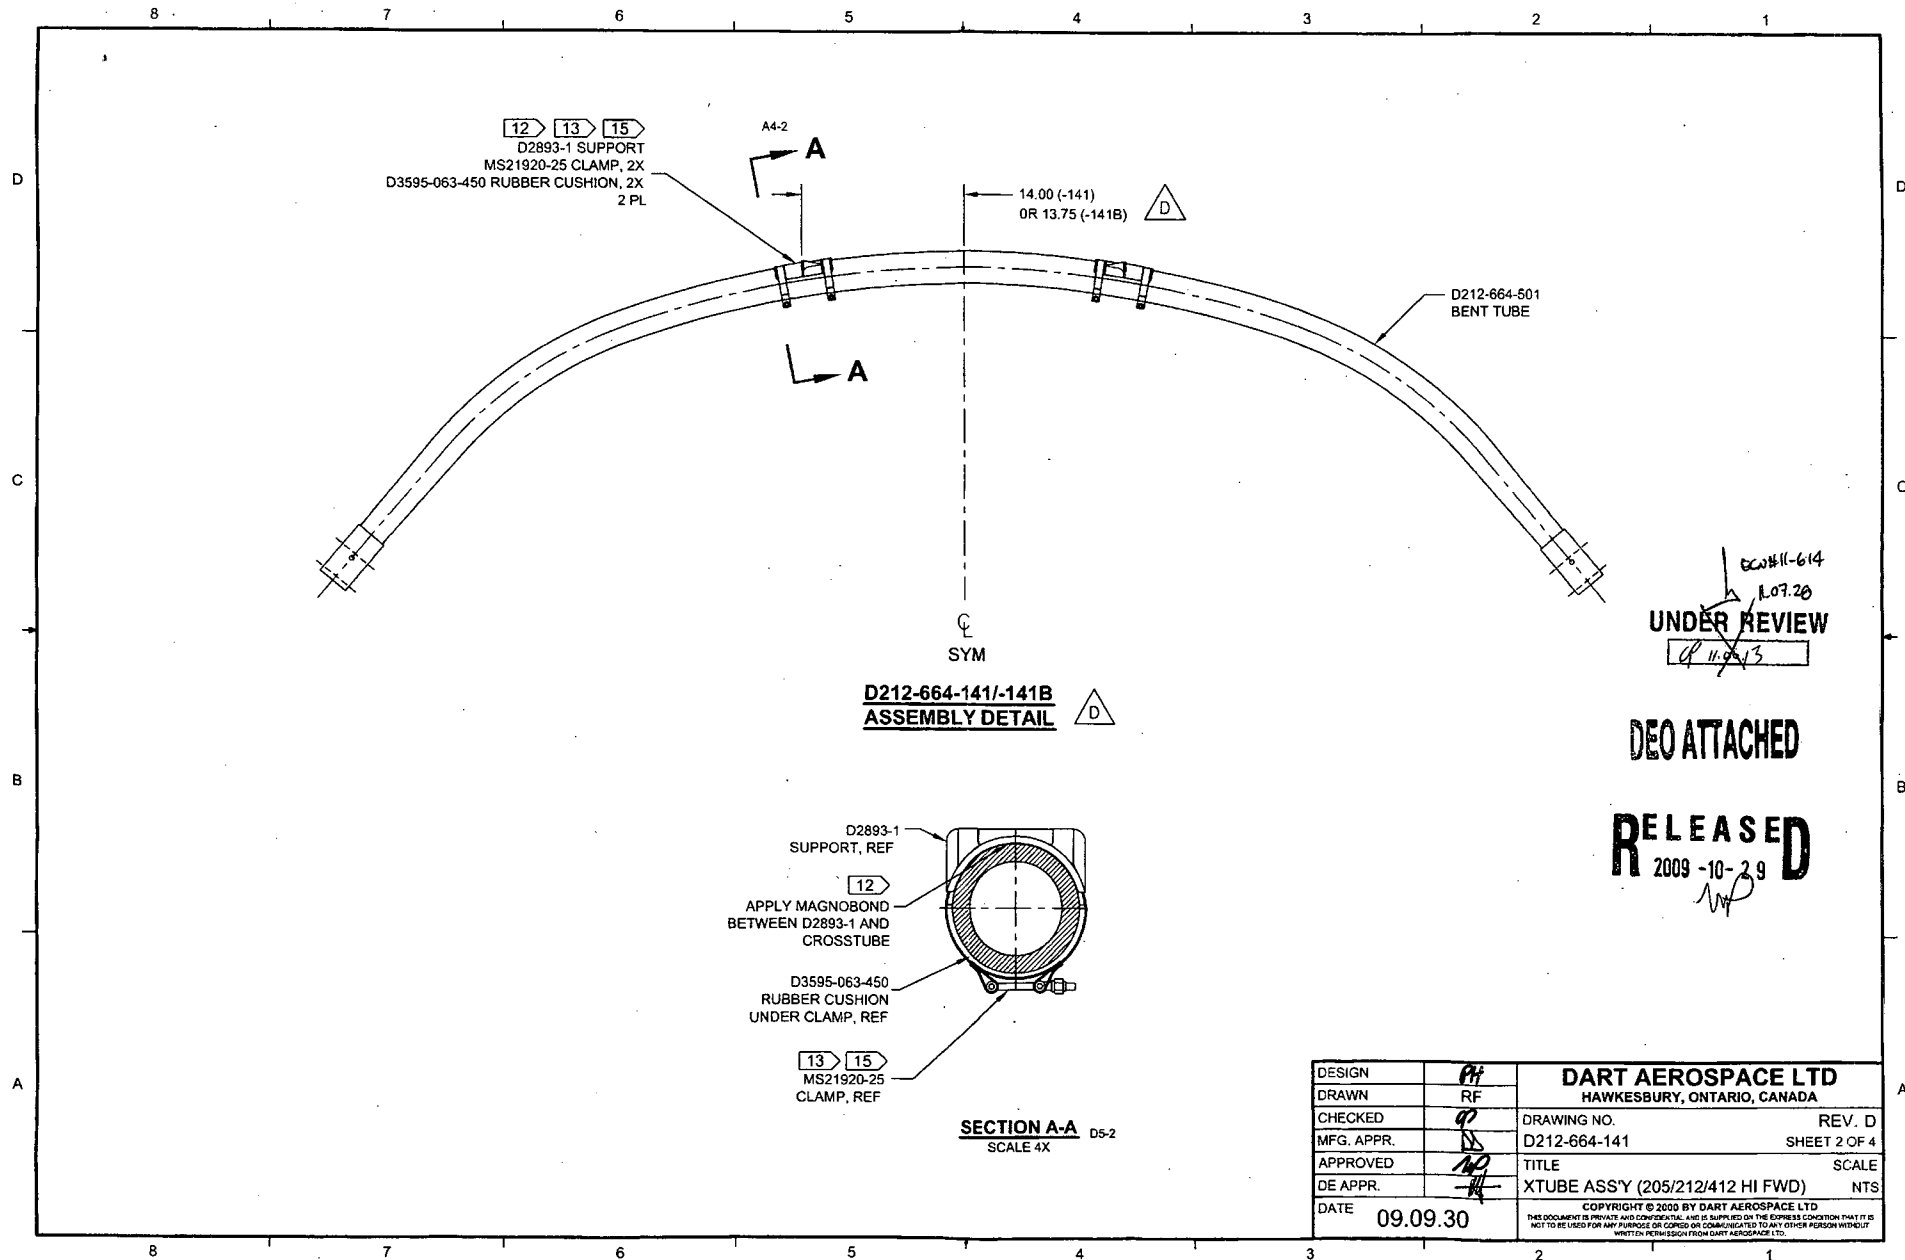

ECW11-614
1.07.20
UNDER REVIEW
CP 11.0.13

DEO ATTACHED

RELEASED
2009-10-29
WJ

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	CP	DRAWING NO.	REV. D
MFG. APPR.	DS	D212-664-141	SHEET 2 OF 4
APPROVED	MP	TITLE	SCALE
DE APPR.	TH	XTUBE ASSY (205/212/412 HI FWD)	NTS
DATE	09.09.30	<small>COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

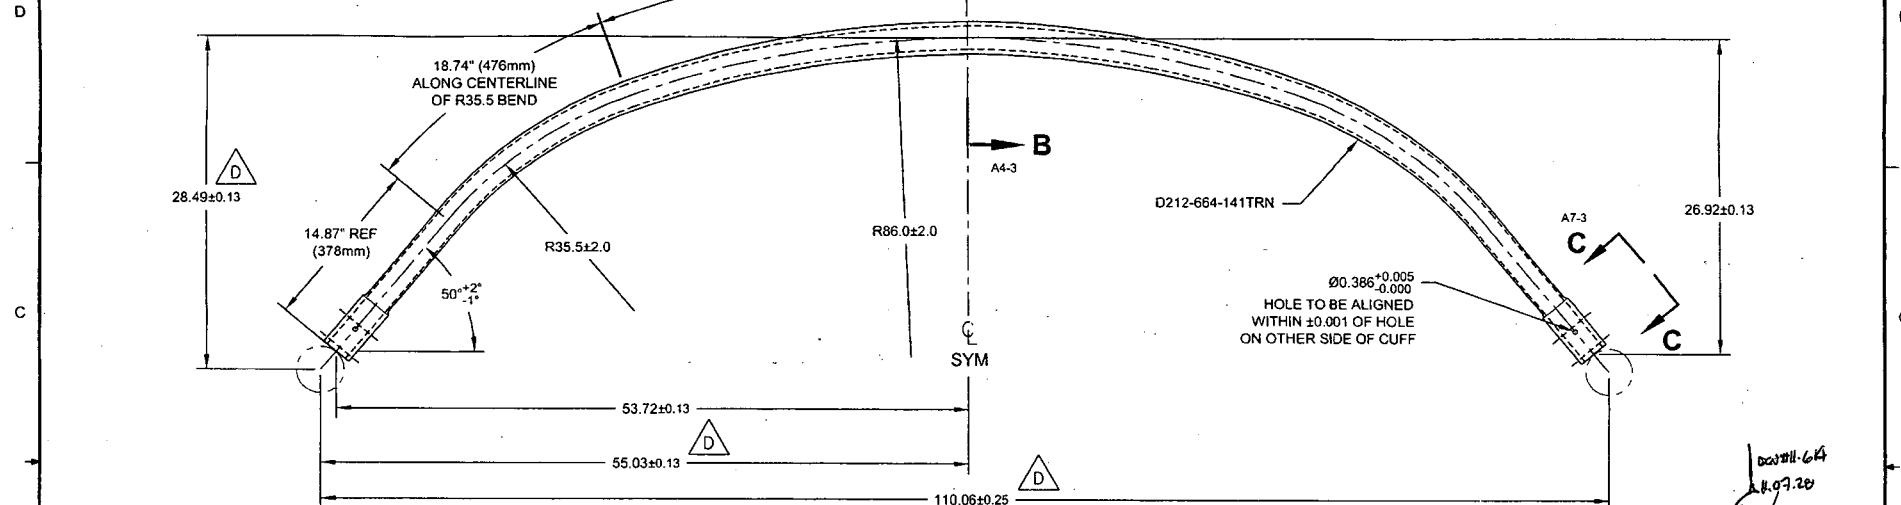


~~Q 11.06.13~~

10 D

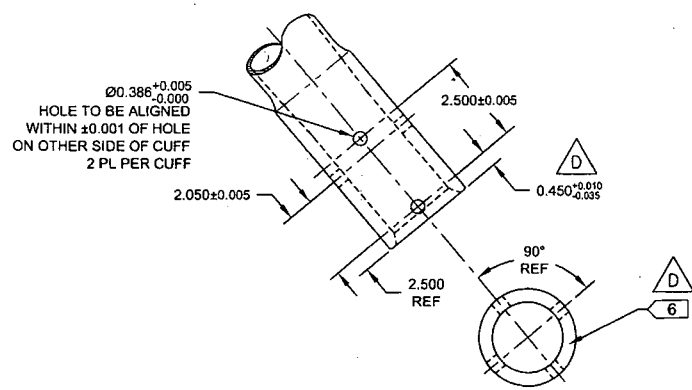

C2-3

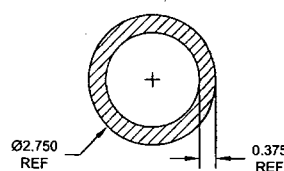

C4-2

RELEASED
2009-10-29

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	9	DRAWING NO.	REV. D
MFG. APPR.	18	D212-664-141	SHEET 3 OF 4
APPROVED	140	TITLE	SCALE
DE APPR.	11	XTUBE ASS'Y (205/212/412 HI FWD) NTS	
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND IS SUPPLIED ON THE UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY OTHER PATTERN WITHOUT THE WRITTEN PERMISSION FROM DART AEROSPACE LTD	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

74330

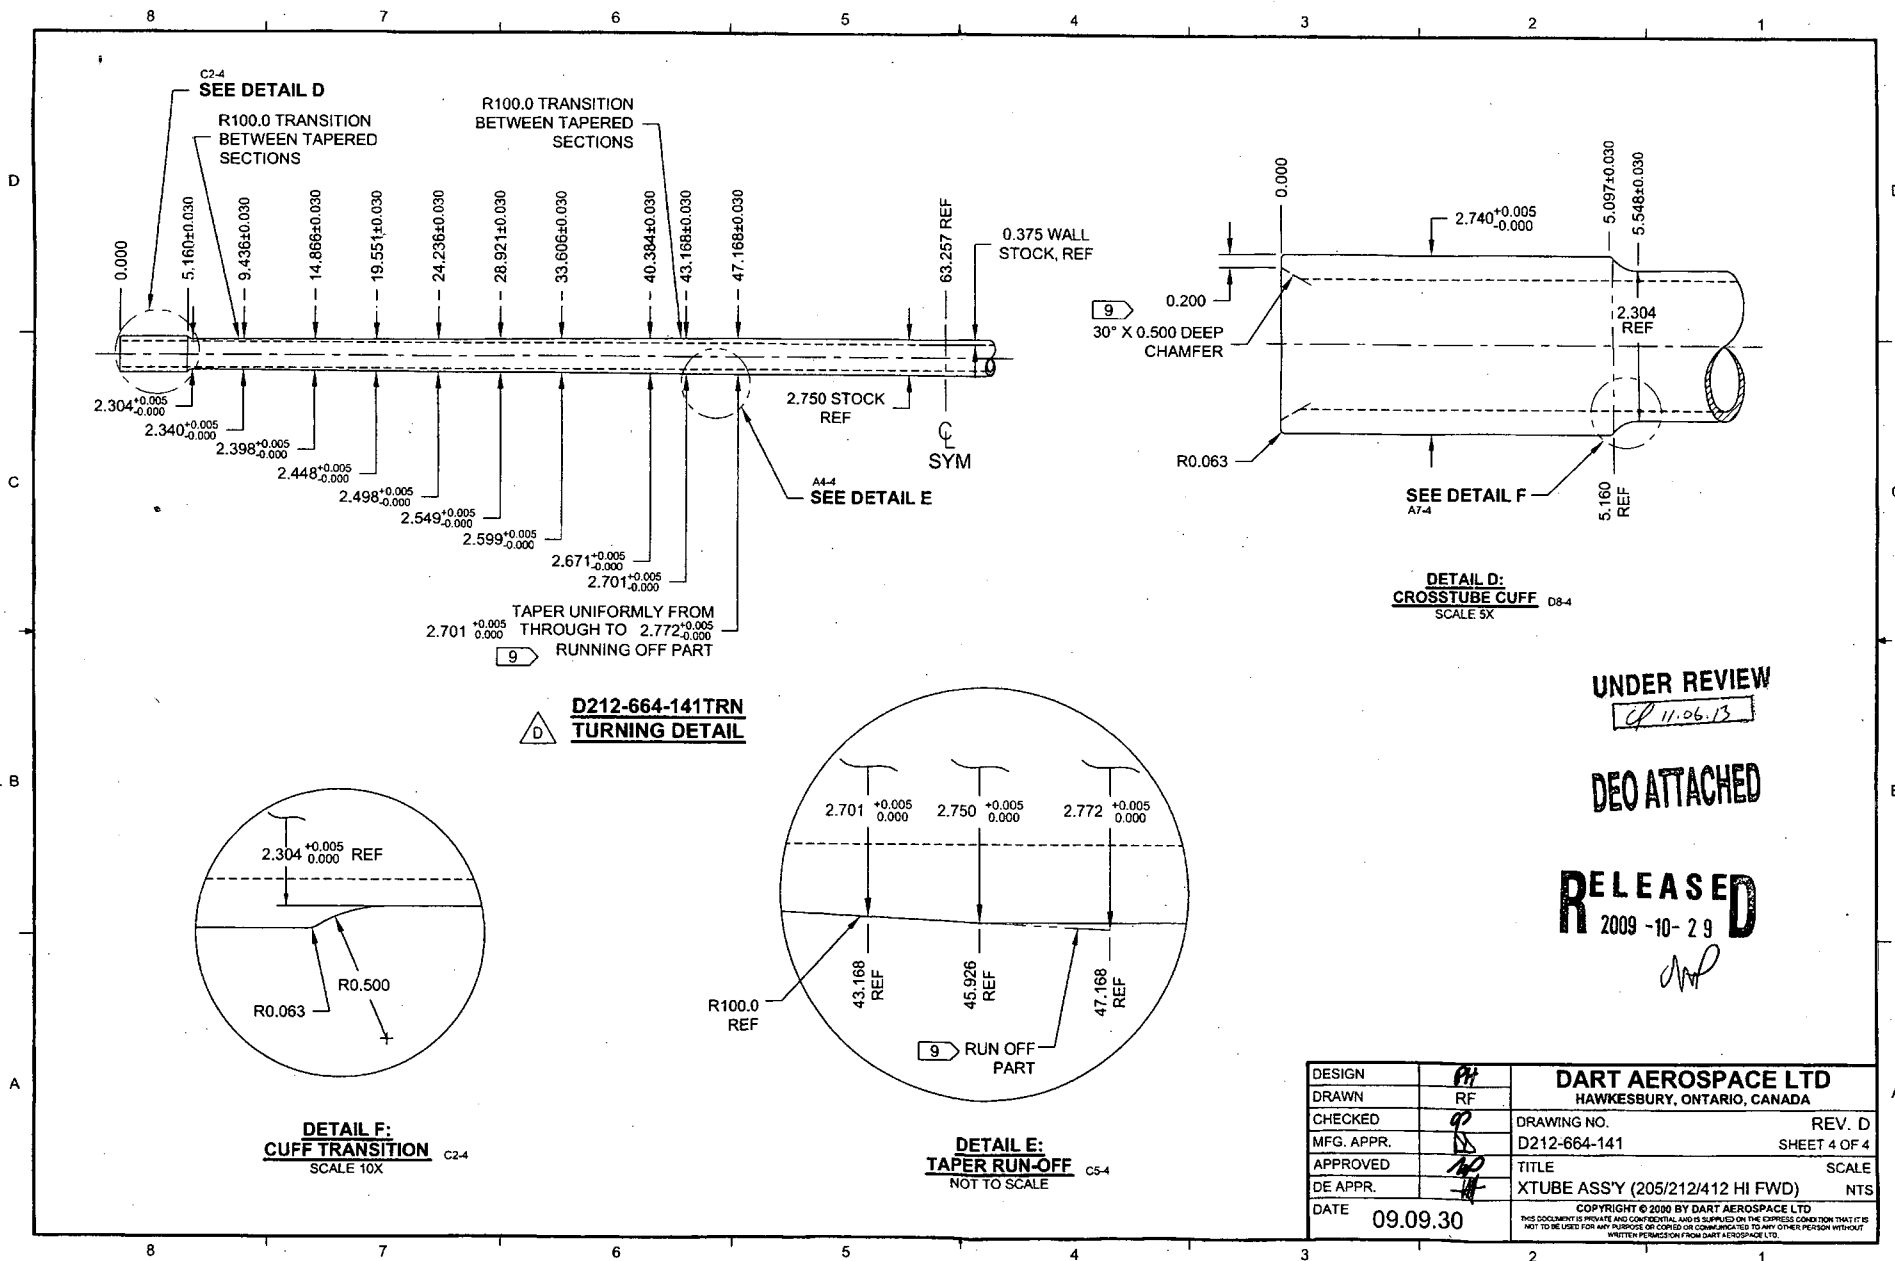

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

74330

DRAWING NO. D212-664-141	TITLE XTUBE ASSY (205/212/412 HI FWD)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-141-D-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN	CHECKED	MP	MFG. APPR.	ER	APPROVED	MP	DE APPR.
DATE	11.04.07	DATE	11.04.11	DATE	11.04.12	DATE	11.04.12

PURPOSE:

ADD AN INSPECTION WINDOW TO UNDERSIDE OF CROSSTUBE.

CHANGE:

NOTES 2 OF SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA) AND
PAINT OUTSIDE PER DART QSI 005 4.2
REMOVE MASKING AND APPLY CLEAR COAT

WAS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2

RELEASED
2011-04-18

UNDER REVIEW

14/106.13
12 02.11-614
11.07.28

COPYRIGHT © 2011 BY DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

74330

DRAWING NO. D212-664-141	TITLE XTUBE ASSY (205/212/412 HI FWD)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D212-664-141-D-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED <i>CP</i>	MFG. APPR. <i>CE</i>	APPROVED <i>WPD</i>	DE APPR. <i>WPD</i>		
DATE 11.04.07	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12	DATE 11.04.12		

IS:


WAS:

UNDER REVIEW


9/11/06.13

ECN# 11-614

11.07.28

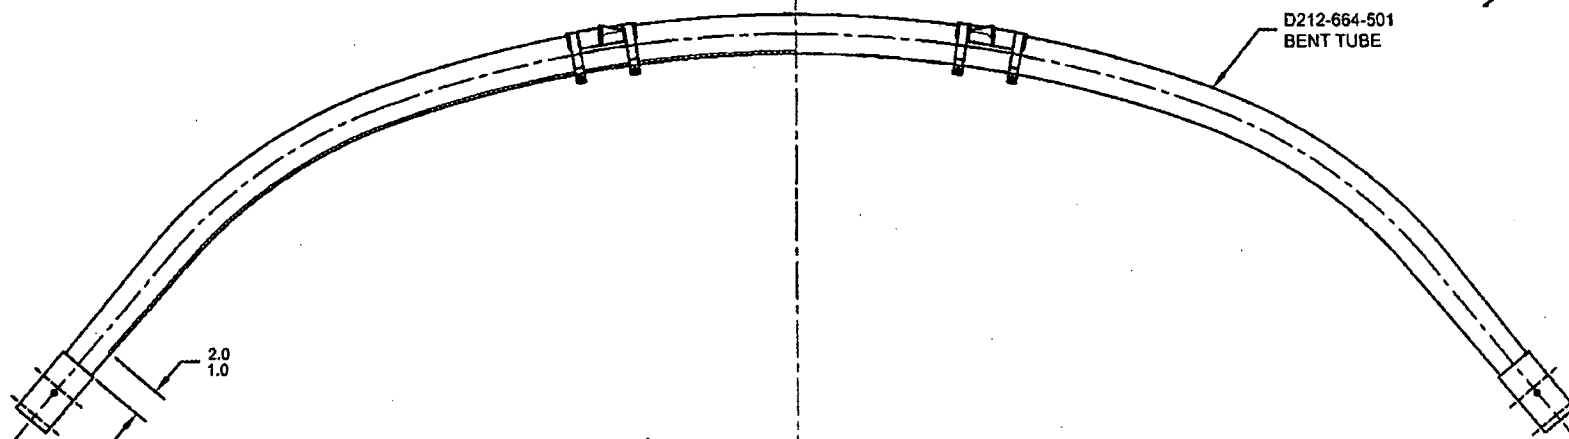

**D212-664-141/-141B
ASSEMBLY DETAIL**

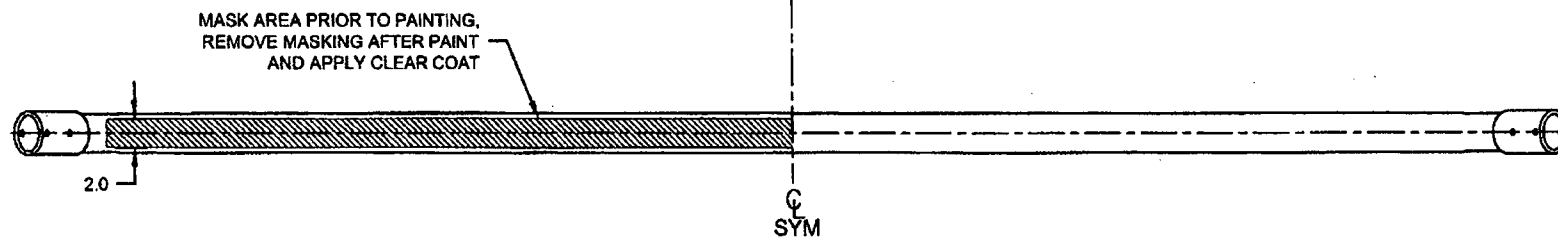

COPYRIGHT © 2011 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

74330

DRAWING NO. D212-664-141	TITLE CROSSTUBE ASS'Y (205 HI FWD)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-141-D-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>UP</i>	CHECKED <i>AS</i>	MFG. APPR. <i>AS</i>	APPROVED <i>MP</i>		DE APPR. <i>MP</i>		
DATE 11.07.15	DATE 11.07.20	DATE 11.07.21	DATE 11/07/21		DATE 11.07.21		

PURPOSE:

REPLACE MAGNOBOND WITH PROSEAL.

CHANGE:**IS:**

Item	Qty -141	Qty -141B	Part Number	Description
7	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) TO INSTALL D2893-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

- 12) INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RECEIVED
2011-07-28
220

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Kim Johnston

From: Chris Provencal <cprovencal@dartaero.com>
Sent: Wednesday, October 05, 2011 11:59 AM
To: David Shepherd
Cc: Mike Petsche; 'Eric Downing'; Johnston, Kim
Subject: NCR D212-664-141

David,

We investigated the following tube because of an observed eccentricity of the material that was noticed after bending. I believe the results are within what I can sign off, however I've FYI'd you on the results to ensure you have no objection. Kim: can you print this, as our printer isn't working.

D212-664-141 B/N 74330

Tube was observed to have an overly eccentric wall thickness on cuff. The thin wall was located along the lower edge of the crosstube (ie. area of high stress). Wall thicknesses were measured along that side of the tube:

Location:	<u>Cuff</u>	<u>5.16"</u>	<u>24.24"</u>	<u>40.38"</u>	<u>63.26" (center)</u>
Wall nominal	0.37"	0.154"	0.249"	0.336"	0.375"
Wall top:	0.404"	0.185"	0.274"	0.368"	0.397"
Wall bottom	0.345"	0.135"	0.246"	0.326"	0.374"
Deviation bot.	-0.025"	-0.019"	-0.003"	-0.010"	-0.001"

Tolerance of D6005 material is:

Wall = +/- 0.015" mean, +/- 0.038" including eccentricity

Tube is within the tolerances of the raw material. In the high stress areas of the tube, the material is with the allowable mean wall thickness (+/- 0.015). The tube has no history of fatigue failure in service. Therefore the tube is acceptable.

-Chris



LIQUID PENETRANT TEST REPORT

P- 05634

ACUREN

CLIENT DART AEROSPACE DATE OCT-14-2011 TIME AM ☒ PM ☐

ATTENTION LYNDA / CHARLIE / VAN / PARTT ACUREN JOB NO. 188-11-02196

ADDRESS 1270, ABERDEEN ST. PO/VO NO. 15157

HAWKESBURY, ON WORK LOCATION AS ADDRESS

PROJECT PT -> WET FLUORESCENT LIQ. PENETRANT ON 'CROSSTUBES' ACCEPTANCE STD. ASTM A7/CST 033 REV./DATE 2005

ITEM(S) EXAMINED - SEE BELOW -

JOB DESCRIPTION PERFORMED A WET FLUORESCENT LIQ. PENETRANT INSPECTION ON 100% OF THE EXTERNAL SURFACE ON ITEMS MENTIONED BELOW

PROCEDURE NO. LT-002 REV./DATE 2007 TECHNIQUE NO. LT-002 REV./DATE 2007

PART NO. ALUMINUM ALUMINUM THICKNESS

SCOPE PERFORMED A WET FLUORESCENT LIQ. PENETRANT INSPECTION ON 100% OF THE EXTERNAL SURFACE ON ITEMS MENTIONED BELOW

TEST DETAILS

METHOD ☒ FLUORESCENT ☐ VISIBLE ☒ WATER WASH ☐ SOLVENT REMOVABLE ☐ POST EMULSIFIED

FAMILY BRAND MAGNAFLUX BLACK LIGHT S/N 13798 OUTPUT > 1000 μ W/cm² ☐ AMBIENT < 2 fc

PENETRANT ZL-67 MINIMUM DWELL TIME 10 MIN. LIGHTING EQUIP. ☐ FLASHLIGHT ☐ TROUBLELIGHT ☐ OUTPUT > 100 fc @ SURFACE

PENETRANT REMOVER H2O MINIMUM DRY TIME >10 MIN. OTHER

DEVELOPER SKD-32 MINIMUM DWELL TIME 10 MIN. LIGHT METER S/N CAL DUE DATE AUG-2011

DEVELOPER TYPE ☒ NON AQUEOUS ☐ AQUEOUS ☐ DRY

TEST SURFACE

SURFACE CONDITION ☐ AS GROUND ☐ AS WELDED ☐ MACHINED ☐ SHOT BLASTED ☒ CLEAN BARE METAL

SURFACE TEMPERATURE ☐ < -4°C/ 20°F ☐ -4°C/ 20°F TO 10°C/50°F ☒ 10°C/50°F TO 52°C/125°F ☐ > 52°C/125°F

RESULTS- (☐ METRIC ☐ IMPERIAL)

ITEM ID	DESCRIPTION	STATUS
1	CROSSTUBE W.O ID 72417	✓
2	72418	✓
3	73042	✓
4	73690	✓
5	73691	✓
6	74330	✓
7	74686	✓
8	74687	✓

NO RELEVANT INDICATION WAS DETECTED AS PER APPLICABLE STANDARDS.

ITEM ID D212-664-201 AFT
D212-664-201 AFT
D212-664-101 FWD
D412-664-203 AFT
D412-664-203 AFT
D212-664-101 FWD
D407-667-105 FWD
D407-667-105 FWD

11.10.17

Scope of Services
The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.

Standard of Care
In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

SIGNATURES

CLIENT REPRESENTATIVE John T. Hey DTR # E 44768

TECHNICIAN (SIGNATURE): JAMES DESROSIERS REPORT REVIEWED BY:

NAME (PRINT): JAMES DESROSIERS NAME INITIALS

1ST TECHNICIAN CGSB LEVEL 2 SNT LEVEL 3049 2ND TECHNICIAN CGSB LEVEL SNT LEVEL

CGSB REG. NO 3049 CGSB REG. NO